Direct Healthcare Group

Advancing Movement & Health®

Bure Ortho Bure Ortho S Bure Space

Technical Manual



BURE ORTHO/ORTHO S/SPACE

TECHNICAL MANUAL


Bure Ortho Bure Ortho S Bure Space


Contents

1. Parts list	04
2. Spare parts	06
3. Accessories	07
4. Remote Control Plus	07
5. Other instructions T-Motion	80
6. General maintenance advice	09
7. Safety instructions	09
8. ID label	09
9. Recycling/Scrapping	09
10. Warranty	09
11. Dimensions	10

1. Parts list

1	Arm rest plate	12	Intermediate frame	22		Control box (T-Motion)
2	Plastic washer	13	Bolts	23		Battery
3	Knob	14	Protective cover	24		Holder/ remote control
4	Upper frame	15	Base frame	25		Remote contro (T-Motion)
5	Attachment bolt (2pcs)	16	End bushing	26	Α	Gas strut
6	Serrated washer	17	Castor		В	Handle
7	Handle and grip	18	Bolt		С	Arm/housing
8	Chromium-plated tube	19	Washer		D	Bolt, washer (2 pcs), nut (attachment at bottom and top)
9	Clamp	20	Cover/green			
10	Knob	21	Actuator (T-Motion)			
11	Guide sleeve					

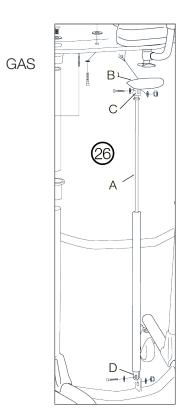

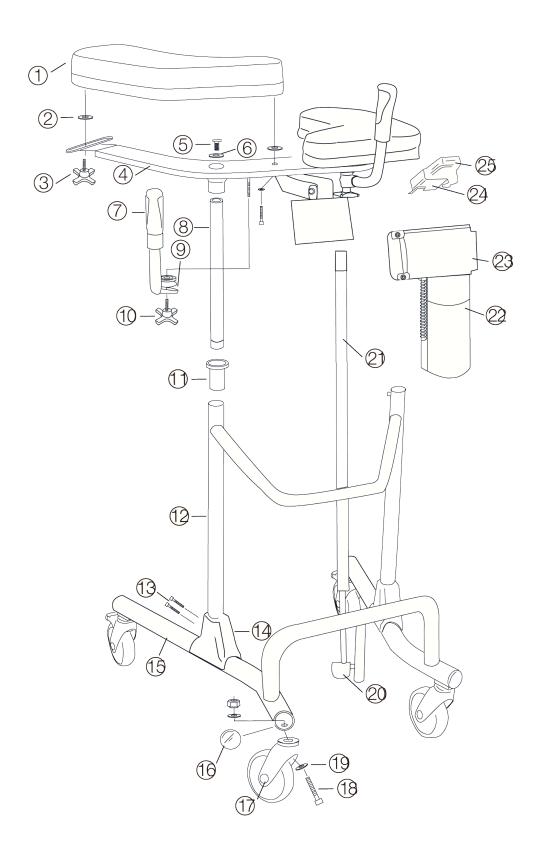

2. Spare parts

No.	Part No.	Description
1	57-357-R	Arm rest plate, right
1	56-357-L	Arm rest plate, left
2	57-904	Plastic washer/Arm support widening
3	56-364	Knob for adj. width of arm rest plates
4	57-356	Upper frame
5	57-816	Attachment bolt, M10x40
6	57-803	Serrated washer
7, 9, 10	56-353	Handle kit (2 pairs incl. attachment knob/clamps)
8	58-311	Guide tube with bronze bushings
10	56-363	Knob for adjusting handle
11	56-340	Guide sleeve
12	57-355	Intermediate frame
13	57-810	Bolt M8x45
14	56-375	Protective cover, plastic
15	57-354	Lower frame Bure Ortho
15	57-354-S	Lower frame Bure Ortho S
15	57-373	Lower frame Bure Space
16	56-344	End piece, lower frame, Black/D45
17	56-361	Castor with brake 125mm
-	56-357	Castor without brake 100 mm
-	56-358	Castor with brake 100 mm
-	56-360	Castor without brake 125 mm
-	56-387	Castor with brake 75 mm
18	-	Bolt M10x50
19	57-848	Nordloc washer
20	58-331	Cover/green (T-motion)
21	58-377	T-Motion - Actuator (Raise/Lower)
22	58-373	T-Motion - Control box 220 V
22	58-373-1	T-motion - Control box 110 V
23	58-376	T-Motion – Battery
24	57-041-2	Holder, hand controller
25	58-374-1	T-Motion – Hand control (Raise/Lower)
-	56-305	Touch-up paint, Bure Silver 8
-	58-326	T-Motion – Power cable, coiled
-	58-326-1	Power cable, coiled UK
-	58-326-2	Power cable, coiled US
-	58-326-3	Power cable, coiled AUS
26A	57-007-1	Gas strut 400mm
26B	57-329	Plastic handle
26C	57-008-2	Lever/Alu

3. Accessories

Part No.	Description
56-326-0	Handbrake kit/2 handles
56-326-1	Handbrake kit/One-handed brake
56-327	Frame elevation kit, 70 mm
56-393	Footplate, short, Bure Ortho/Space
56-383	Footplate, long, Bure Ortho/Space
56-392	Drip holder
56-335	Attachment for drip holder
56-336	Oxygen holder
56-337	Side support, adjustable
56-338	Drip rod complete with attachment
56-389	Soft basket with attachment
56-061	Remote control PLUS (TH10) including Holder

4. Remote Control Plus

**1. Service indicator – flashes red after 11 months' operation. Constant light (red) after 12 months' operation. The indicator is a reminder to review the maintenance instruction (see Instructions for Use/Technical Manual. This should be done at least once every 12 months.

Reset: hold down buttons <2a> + <2b> for at least 30 seconds.

**The indicator will go out around 30 seconds after the remote control is activated (battery conservation function).



5. Other instructions T-Motion

Control box wiring

Remove the control box cover to make the connections as described below. Use a screwdriver or similar; refer to the special labels on the control box.

- 1. Socket for the raise/lower actuator. NOTE: Make sure that plugs are connected to the correct sockets otherwise the actuators can be damaged.
- 2. Remote control socket.
- 3. Battery terminal socket.
- 4. Plug socket. NOTE: The plug must ALWAYS be connected to the control box for IP protection to be valid.

Battery charging

- Connect plug to 230V wall socket. Charging begins automatically and the battery LED flashes green.
- Make sure the battery is fully charged before using for the first time. It takes around 25 h to fully charge the battery.
- We recommend that the battery plug be removed from the control box if the product will be out of use for an extended period (more than one week) or if the battery is switched off by means of the ON/OFF switch. This eliminates the risk of disabling the battery as the control box always uses a small quantity of electricity even when the walker is not in use.



LEDs on control box and battery

Control box – green light when power is available from battery/mains socket.

Battery:

- The LED flashes green during charging.
- ON/OFF: To use the product, press ON.
- The green lamp will begin to flash.
- Use the OFF button (hold down for 5 s) to switch off the battery if the product will not be used for an extended period.
- The LED will shows a constant green light when the battery is fully charged.
- When the battery is in normal state/in operation, the LED flashes green at REGULAR intervals, namely 0.5 s ON, 4 s OFF.

When the battery requires charging (remaining charge <25%) the LED will flash orange/red at REGULAR intervals, namely 0.5 s ON, 4 s OFF.

NOTE: The battery has an in-built device that automatically switches it off when remaining charge is <20%. The LED is then extinguished. The battery must now be fully charged before the electronics can be used again.

6. General maintenance advice

- Wipe the walker and its armrests clean as necessary; use soap solution or alcohol-based surface disinfectant.
- The product may be cleaned in a tunnel washer or similar as electrical systems have IP65 protection. However, the product is not corrosion proof which means washing by machine may reduce its service life.
- Replace damaged parts immediately; must be done by experienced personnel.
- The product is only intended for indoor use.

7. Safety instructions

Bure Walker may only be used:

- As a WALKING AID indoors
- on HARD, LEVEL surfaces

MAX USER WEIGHT: 150 KG

8. ID label

- 1. Part number
- 2. Product name
- 3. Date of manufacture
- 4. Max user weight
- 5. Serial number
- 6. EAN code

56-317T Cabord Bure Ortho 3 2011-04-20 SN 2468 4 Max 150 Kg CE Bredd/Width/Breite (cm): 78 -- 81 Endast for bruk INOMHUS Only for INDOOR useage Nur fur im HAUSE Benutzen. 6 (01)07350013563126(21)2468

9. Recycling/Scrapping

When the product is no longer usable it should be recycled in accordance with legislation and regulations in the country concerned. All electrical parts including batteries must be removed and recycled as electrical components. (Ask your local recycling station for further information about how the different materials in the product (metals, plastics, electronics) should be recycled).

10. Warranty

We provide two years' warranty for manufacturing faults (does not apply to wear parts).

11. Dimensions


Ortho, S, Space

Product weight 20kg (Gas 15kg)

Product height 90-130cm

"LIFT" denotes suitable handhold for lifting the walker.

NOTE: At least two people are required for lifting.

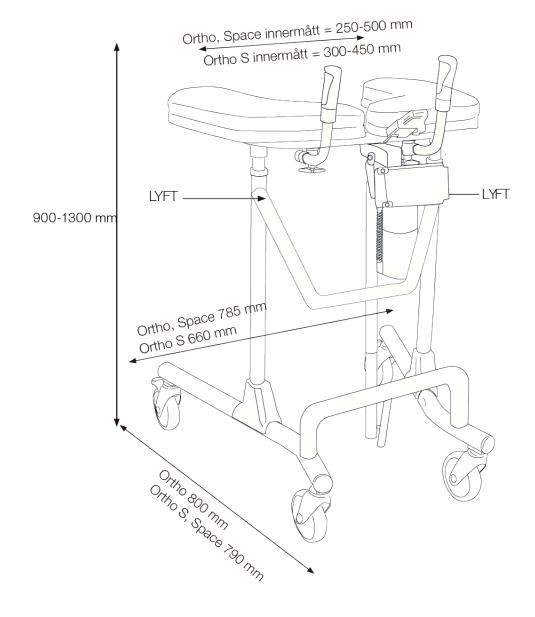

TECHNICAL MANUAL

Direct Healthcare Group

Advancing Movement & Health®

Direct Healthcare Group Withey Court, Western Industrial Estate Caerphilly CF83 1BF

T: 0800 043 0881 F: 0845 459 9832

E: info@directhealthcaregroup.com

LIT-00133 Issue 1 Date: January 2020